

# TOYOTA TECHNICAL SERVICE BULLETIN

REF.: BODY  
 NO.: BO95-006  
 DATE: JULY 28, 1995  
 MODEL: GB (AVALON)


## AVALON WINDSHIELD MOLDING WIND NOISE

Page 1 of 2

TMM has implemented a production process change to improve windshield sealing.

EFFECTIVE DATE	VIN REFERENCE
4/26/95	4T1GB11E5SU038470

To eliminate whistling noise from the windshield top outside molding, fill in the windshield channel with a urethane sealant such as **3M Window Weld Re-sealant** or equivalent (refer to illustration below for proper application).

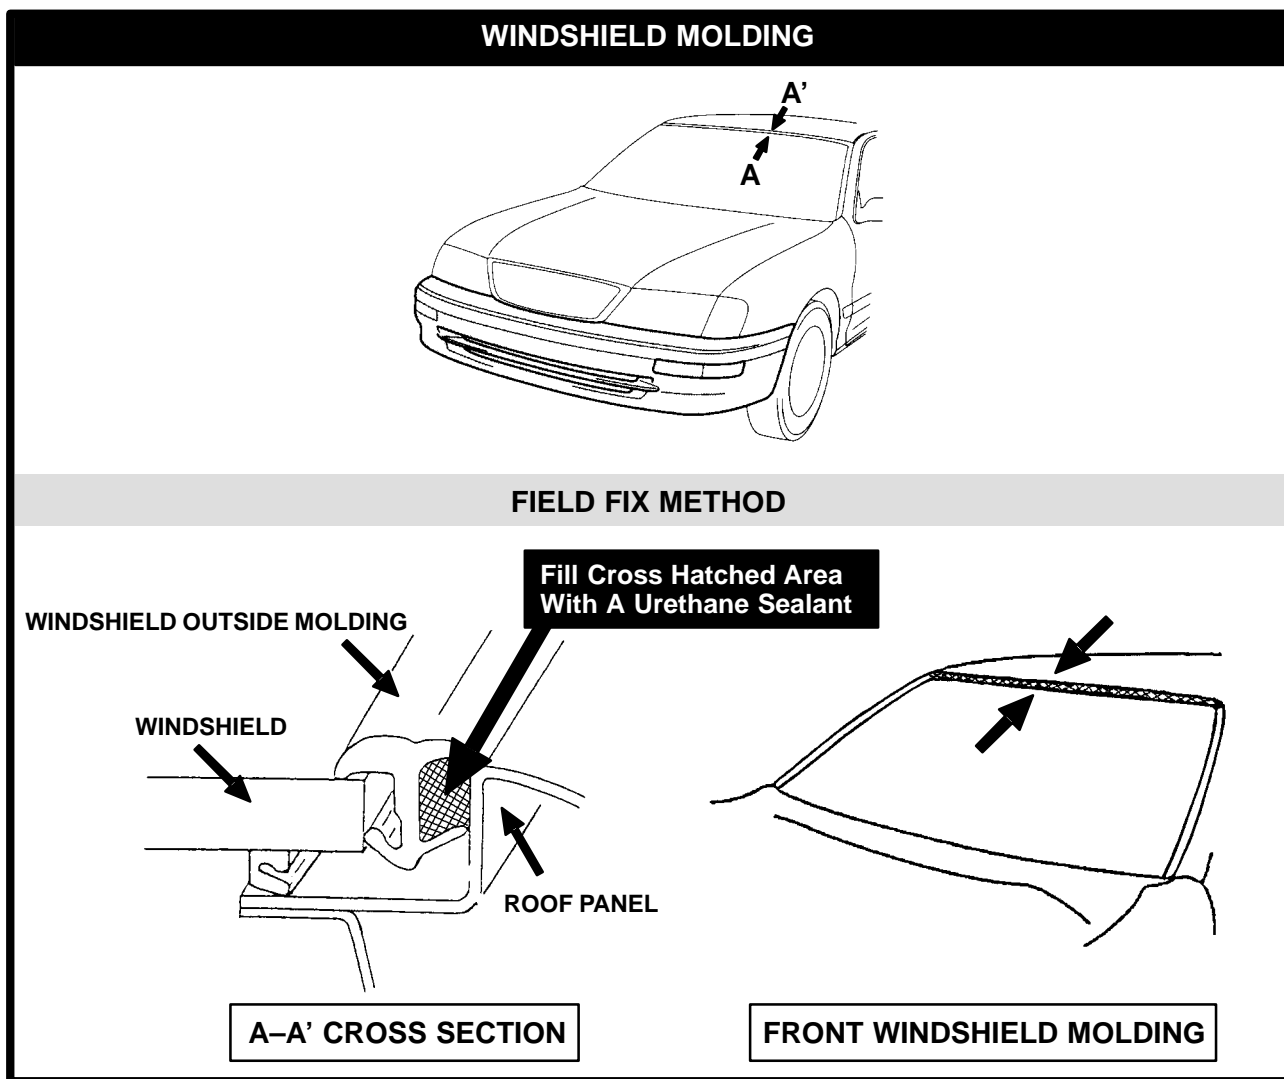

**WARRANTY INFORMATION:**

<b>OPCODE</b>	<b>DESCRIPTION</b>	<b>TIME</b>	<b>OPN</b>	<b>T1</b>	<b>T2</b>
BO5001	Front Windshield Molding	0.3	75531-07010	91	41